

Compiled by: E Larimer

Date: Oct, 2025

ENGINEERING AND TRAFFIC SURVEY

I. Road Soda Springs Road (Segment 1 of 2)

From Donner Pass Road

- To Cross Walk 1100ft south of Donner Pass Road
- II. Reason for Study: Five Year Speed Zone Update
- III. Roadway Characteristics:
 - a. Width
- 24 feet
- b. Surface
- Asphaltic Concrete
- c. Striping
- Double yellow centerline
- d. ADT
- 1,831
- e. Length
- 0.19 miles
- IV. Roadside Characteristics: The segment is rural with moderate sight distance. Soda Springs Mountain Resort is accessed from Soda Springs Road and generates additional traffic during winter months.
- V. Existing Speed Zone: 35 miles per hour
- VI. Prevailing Speed:
 - a. 10 miles per hour pace
- 29 38 miles per hour
- b. Average speed
- 33 miles per hour
- c. 85th percentile

Road over the last five years.

- 37 miles per hour
- VII. Accident History: There was one reported accidents on this segment of Soda Springs
- VIII. Other Factors of Significance: The road crosses a pair of railroad tracks approximately 380ft south of Donner Pass Road. As well as a crosswalk with significant pedestrian traffic during the winter season.
- IX. Is a Speed Zone Warranted: Yes
- I. Recommendations: California Vehicle Code Section 22358.6 allows for the 85th percentile speed to be rounded to the nearest 5 mph increment and then reduced by 5 mph if conditions exist that are not readily apparent to drivers. This section has multiple features that are not readily apparent to drivers, and it is recommended that the section be posted at 30 miles per hour.

Patrick Perkins P.E., CCM Principal Civil Engineer



Compiled by:

E Larimer

Date: Oct, 2025

ENGINEERING AND TRAFFIC SURVEY


I. Road Soda Springs Road (Segment 2 of 2)

From Cross Walk 1100ft south of Donner Pass Road

To Placer County Line


- II. Reason for Study: Five Year Speed Zone Update
- III. Roadway Characteristics:
 - a. Width
- 24 feet
- b. Surface
- Asphaltic Concrete
- c. Striping
- Double yellow centerline
- d. ADT
- **-** 1,831
- e. Length
- 0.34 miles
- IV. Roadside Characteristics: The segment is open rural moderate sight distance. Soda Springs Mountain Resort is accessed from Soda Springs Road and generates additional traffic during winter months.
- V. Existing Speed Zone: 35 miles per hour
- VI. Prevailing Speed:
 - a. 10 miles per hour pace -
- 29 38 miles per hour
- b. Average speed
- 33 miles per hour
- c. 85th percentile
- 37 miles per hour
- VII. Accident History: There were two reported accidents on this segment of Soda Springs Road over the last five years.
- VIII. Other Factors of Significance: The road crosses a pair of railroad tracks approximately 380ft south of Donner Pass Road. This segment ends at a crosswalk that has significant pedestrian traffic in the winter.
- IX. Is a Speed Zone Warranted: Yes
- X. Recommendations: The California Manual of Uniform Traffic Control Devices indicates that when a speed limit is to be posted, it should be established at the nearest 5 mph increment of the 85th percentile speed. The 85th percentile speed for this study is in alignment with the posted speed limit of 35 miles per hour. It is recommended that this section remain posted at 35mph.

Patrick Perkins P.E., CCM Principal Civil Engineer

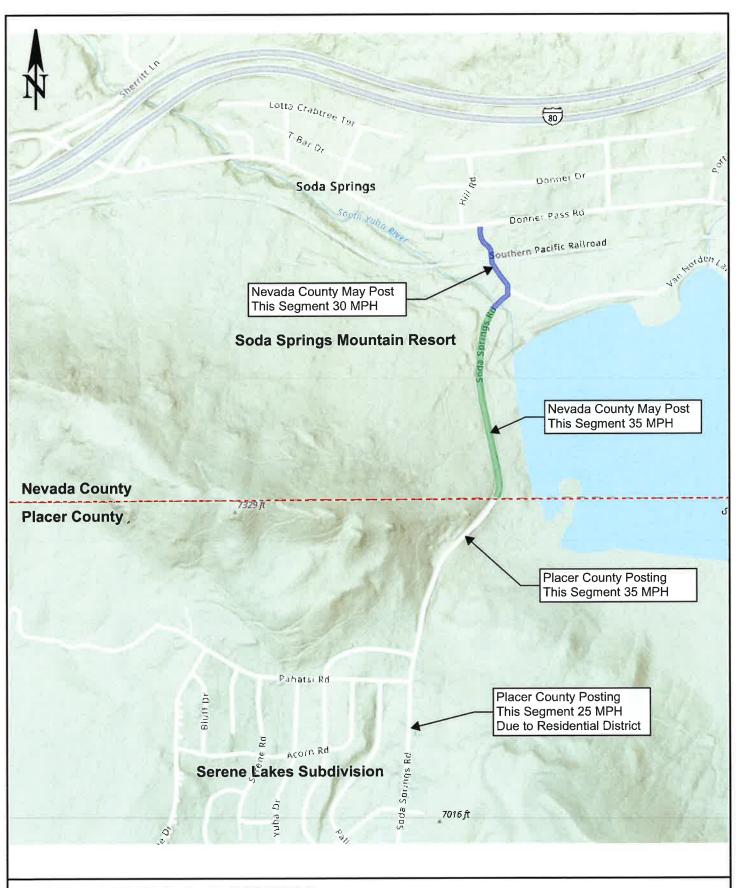



Soda Springs Road Speed Limits

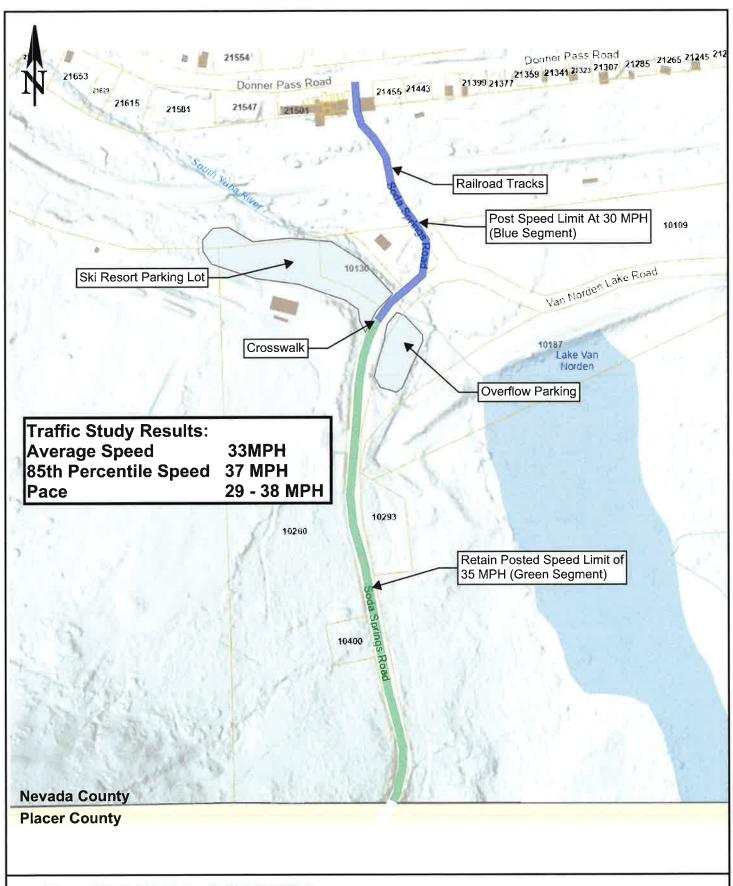



Soda Springs Road Speed Limits

Speed	# of cars	Cumulative	Avg speed calc	Pace calc	Page Range	
15	27	1 0	405			
16			368			
17						
18						
19					160	ID.
20						
21					140	.0
22					120	ND.
2						u
24					15 - 24	10
25					16-25 17-26 18-27 19-28	
26					17 - 26 80	0
2					18 - 27	
28					25 25	Ю
25					20 - 29	
30					21 - 30 40	40
31					22 - 31	
33					23 - 32 20	.0
33					24 - 33	0
34					25 - 34	Ŭ
35					26 - 35	
36					27 - 36	
3					28 - 37	
38					29 - 38	
35					30 - 39	
40					31 - 40	
41					32 - 41	
47					33 - 42	
4					34 - 43	120
44					35 - 44	
45					36 - 45	100 -
46					37 - 46	
4					38 - 47	80 -
41					39 - 48	
45					40 - 49	60 -
50					33 - 46 38 - 47 39 - 48 40 - 49 41 - 50 42 - 51 43 - 52	
5					42 - 51	40 -
57					43 - 52	
5					44 - 53	20 -
54					45 - 54	55
55	5 0	100		59	46 - 55	0 -

	Previous		Current		
Average Speed	T .	33	33	33 Rounded	
85th Percentile		37	36.72		37
Pace	2	8-37	29 - 38		

Date: 9/2/24 to 9/6/24 Observer: E Larimer

Posted Speed: 35 Dat
AC Width: 24 Observe
Weather: Sunny
Location of Survey: 200 Ft North of Placer County Line

